

3M™ Speedglas™ 9000 Welding Headtop for 3M™ Adflo™ Powered Air Turbo Unit

Care and Maintenance



When connected to the 3M Adflo Powered Air Turbo Unit, the 3M Speedglas 9000 Welding Headtop provides eye, face and respiratory protection for increased comfort and safety for welders.

Before Use

- Inspect inner and outer protection plates and filter glass. Replace if cracked, pitted or scratched
- Ensure low battery indicator is not flashing
- Inspect headband. Replace if damaged
- Inspect helmet for cracks. Replace if necessary
- Verify the sweatband is in place. Replace if necessary
- Inspect face seal. Replace if damaged or dirty
- Replace any accessories used as necessary

Monthly

- Carry out all 'Before Use' inspections and create record of this monthly check for the unit

After Use

- Clean with cloth dampened with a mild solution of detergent and luke warm water
DO NOT rinse or immerse in water
DO NOT clean with solvents
- Store in a dry, clean area / locker away from direct sunlight, high temperatures and solvents

Ordering Consumables, Repair Parts and Accessories


To request a quote or place an order for these items, please contact your 3M Approved Distributor.

Further Information and Advice

If you require additional guidance on the Care and Maintenance of your 3M Welding Equipment, please contact the Helpline or your local 3M representative.

3M Health & Safety Helpline
Monday - Friday 9 to 5
0870 60 800 60 UK
1 800 320 500 IRELAND

EMR
PELLTOR

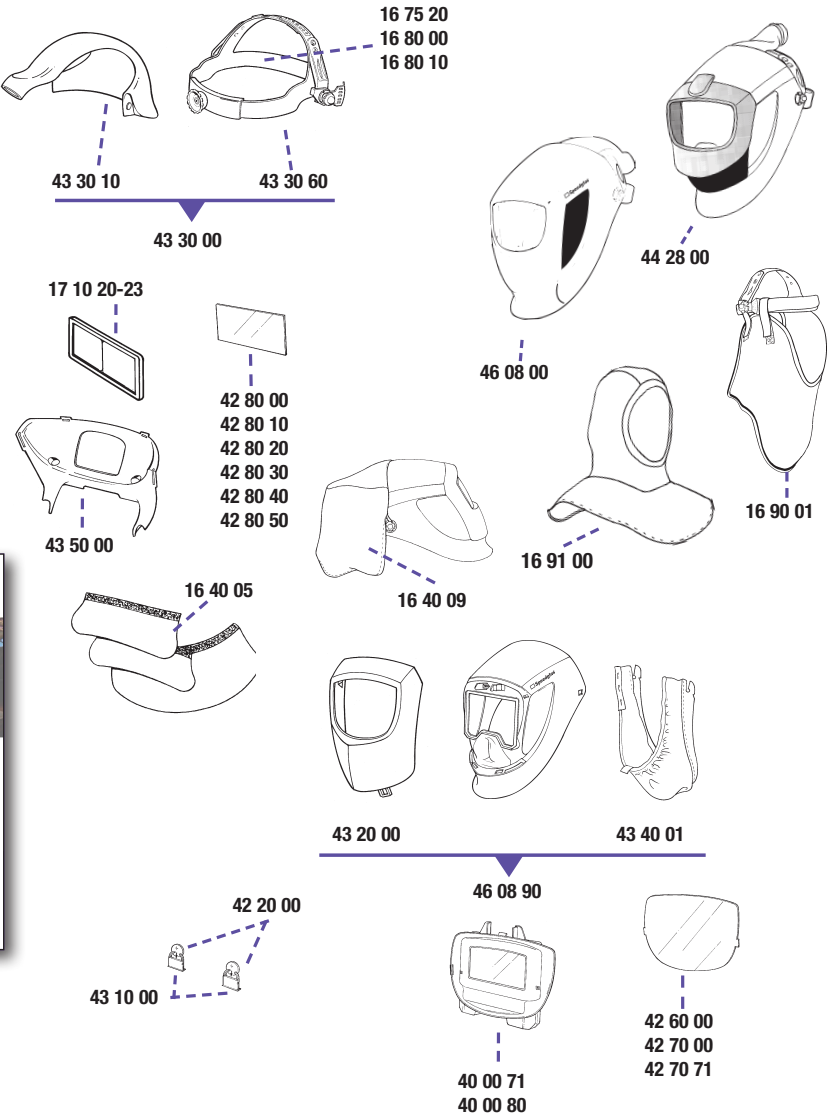

Accessories & Spare Parts Speedglas 9000 Welding Headtop	3M Part No
Ear and throat protection in leather (3 parts)	16 40 05
Head cover, big	16 40 09
Sweatband towelling (2 pcs)	16 75 20
Sweatband in leather	16 80 00
Sweatband fleece	16 80 10
Throat cover	16 90 01
Throat / head cover	16 91 00
Magnifying lens 1.0	17 10 20
Magnifying lens 1.5	17 10 21
Magnifying lens 2.0	17 10 22
Magnifying lens 2.5	17 10 23
Speedglas 9002V welding filter, variable shade 9-13	40 00 70
Speedglas 9002X welding filter, variable shade 9-13	40 00 80
Speedglas 9002D welding filter, dual shade 9/11	40 00 40
Battery (pk of 2)	42 20 00
Outer protection plate standard (pk of 10) plate marking 42 01 50	42 60 00
Outer protection plate scratch resistant (pk of 10) plate marking 42 01 00	42 70 00
Outer protection plate heat resistant (pk of 10) plate marking 42 01 70	42 70 71
Inner protection plate (42x91 mm) Speedglas 9000F/9002V (pk of 5) plate marking 42 02 00	42 80 00
42 80 10 Inner protection plate (53x103 mm) Speedglas 9002X/9000XF (pk of 5) plate marking 42 02 10	42 80 10
Inner protection plate +1 Shade number Speedglas 9000F/9002V (pk of 5)	42 80 20
Inner protection plate +1 Shadenumner Speedglas 9002X/9000XF (pk of 5)	42 80 30
Inner protection plate +2 Shade number Speedglas 9000F/9002V (pk of 5)	42 80 40
Inner protection plate +2 Shade number Speedglas 9002X/9000XF (pk of 5)	42 80 50
Battery cover (pk of 2)	43 10 00
Heat reflecting silver front	43 20 00
Headband with air duct	43 30 00
Air duct	43 30 10
Headband without air duct	43 30 60
Face seal	43 40 01
Air spreader	43 50 00
Speedglas FlexView welding helmet for respiratory protection	44 28 00
Speedglas welding helmet for respiratory protection	46 08 00
Speedglas welding helmet with air spreader, face seal and heat reflecting silver front	46 08 90

@3M_UK_Safety

3M Personal Safety Division
3M United Kingdom plc
3M Centre
Cain Road, Bracknell
Berkshire RG12 8HT
Tel: 0870 60 800 60
www.3M.co.uk/safety

3M Ireland Limited
The Iveagh Building
The Park
Carrickmines
Dublin 18
Tel: 1 800 320 500

17808
3M, Speedglas and Adflo are trademarks of 3M Company
Please recycle. Printed in UK.
© 3M 2014. All rights reserved.

**REPLACE ALL DAMAGED PARTS IMMEDIATELY TO ENSURE
CORRECT LEVELS OF PROTECTION**



CH9000AIRWCMP

To download this poster please visit:
www.3M.co.uk/maintenancepack or scan the QR code

