



Operation Equipment Key




Stage 1: Loading bung device

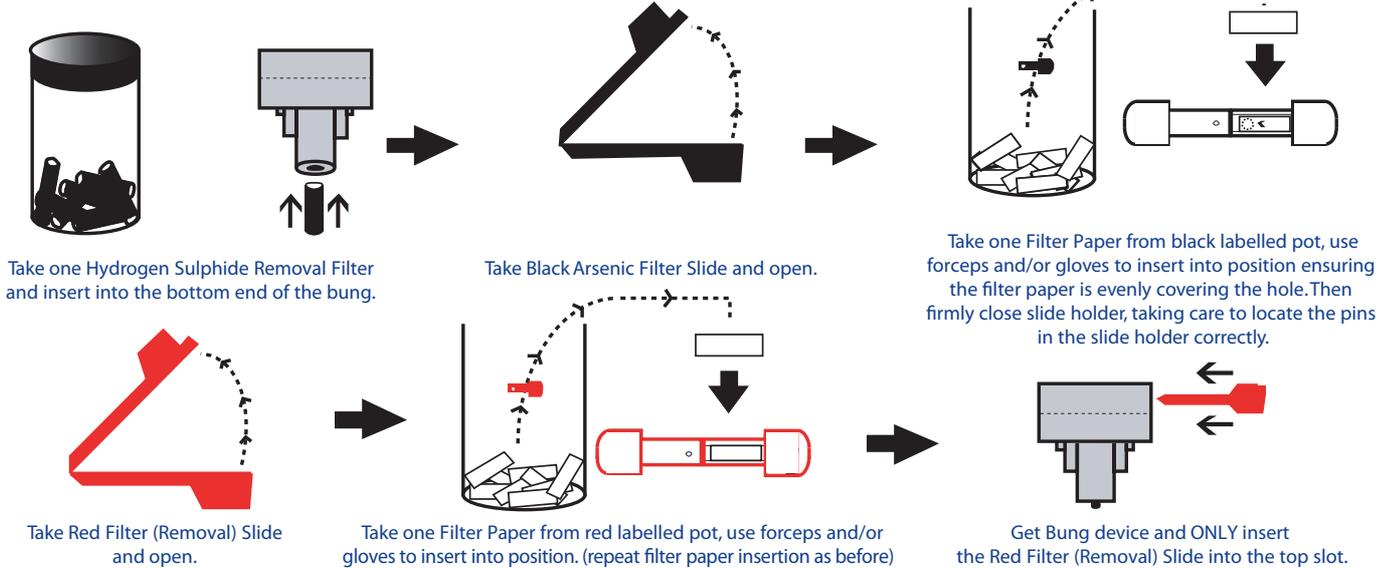


Stage 2: Calibrating the DigiPASs

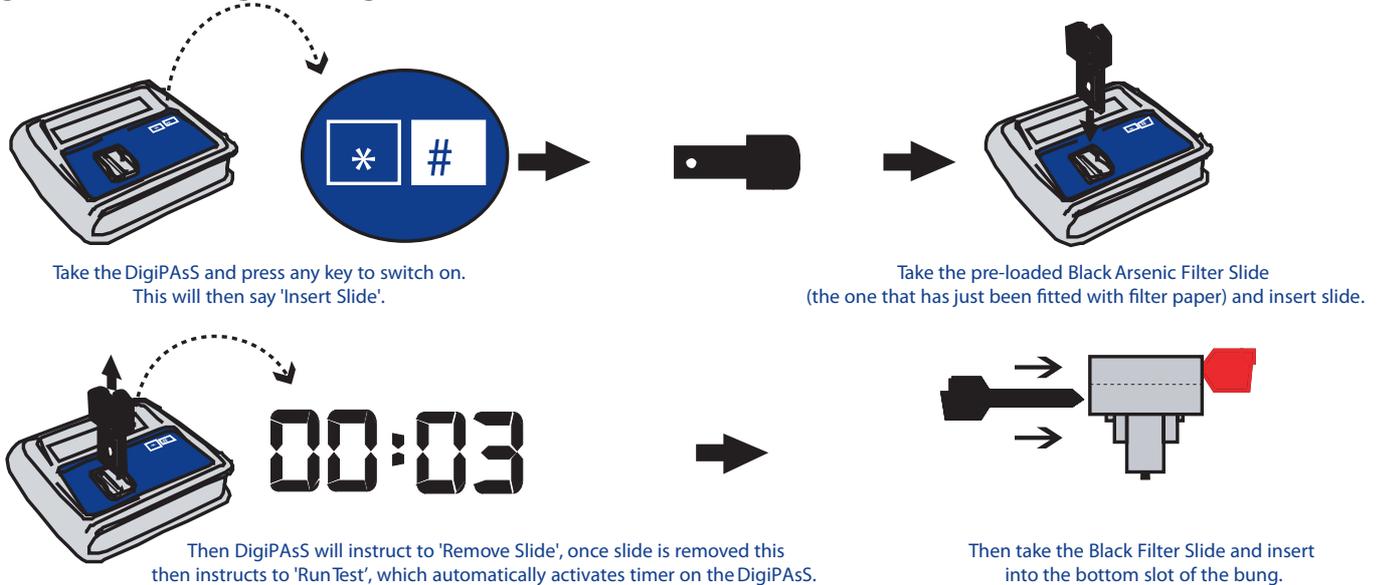

Stage 3: Sample Preparation

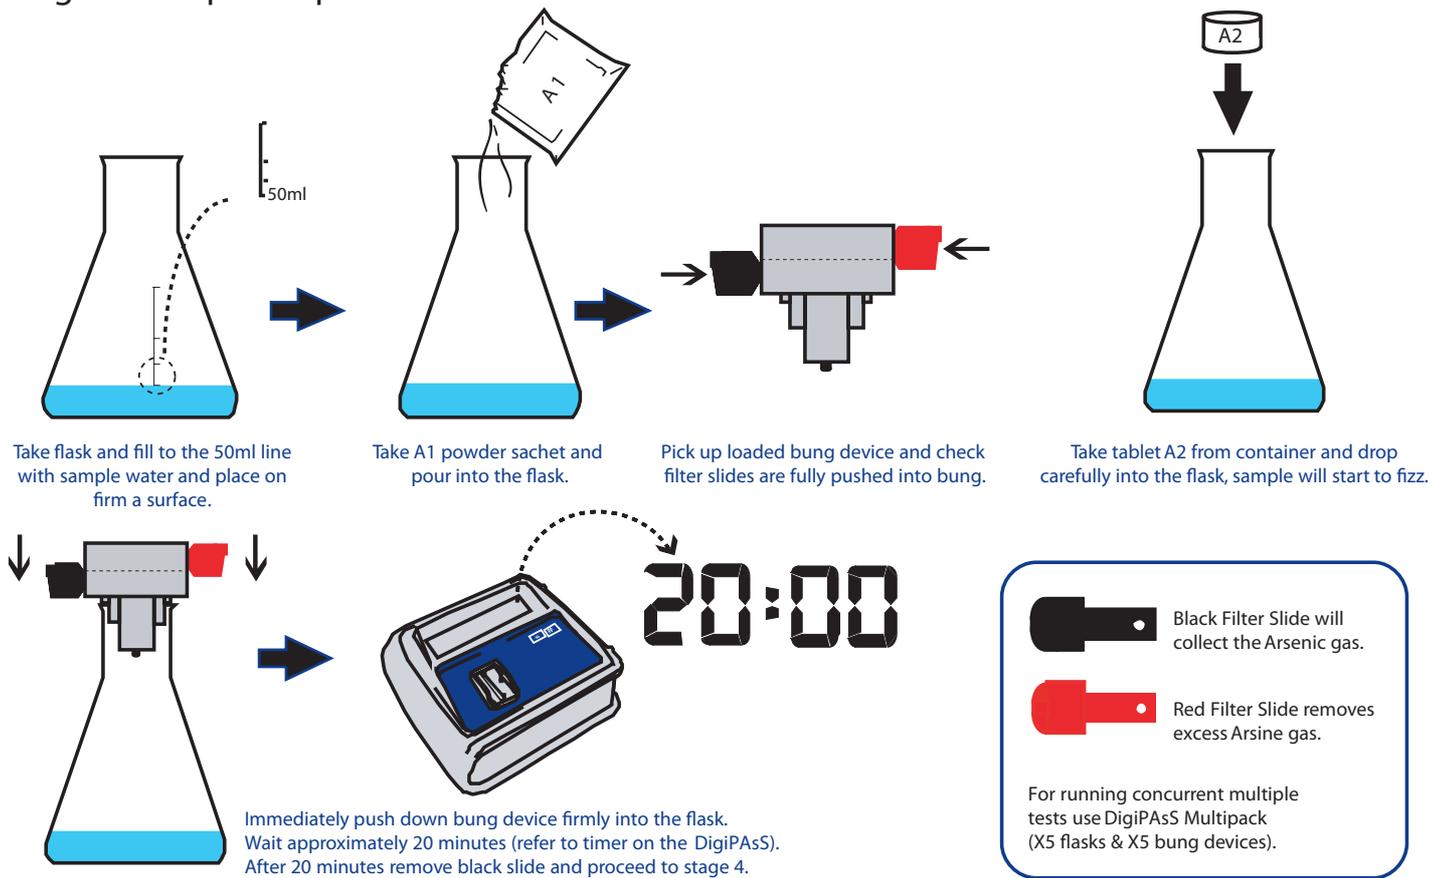

Stage 4: Arsenic Measurement

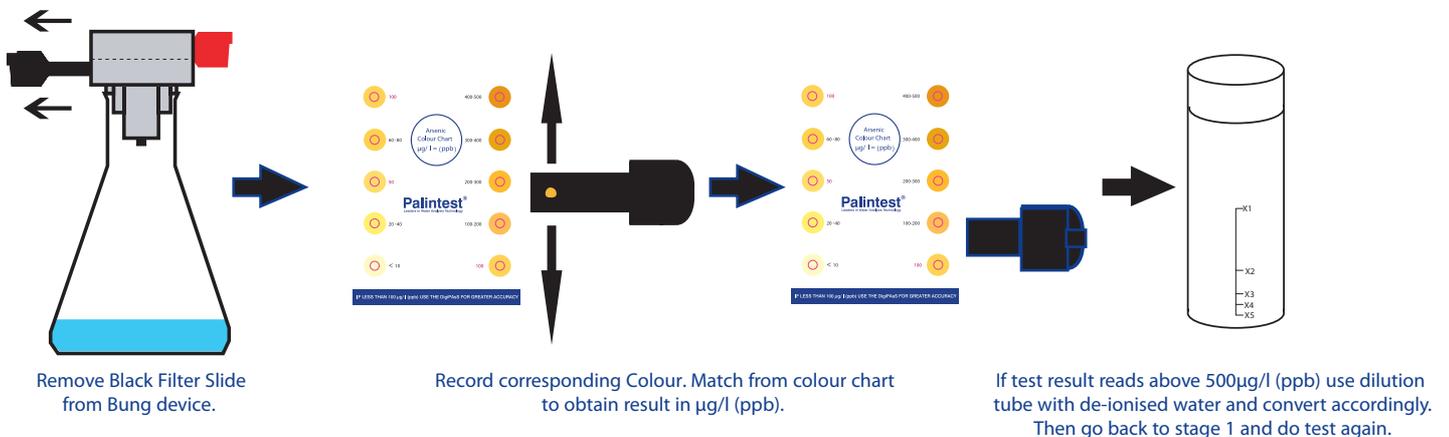

Stage 5: Using the DigiPAS5

