



# 3M™ 600 Series Headtops HT-629



## Care and Maintenance

To maintain protection levels, optimise the effective lifetime of the system and avoid the additional cost of replacement, it is extremely important to carry out regular checks and maintenance on Powered and Supplied Air Respirators.

### Before Use

- Inspect Comfort Band – remove and replace if necessary
- Inspect Face Seal – ensure it is free from holes or tears
- Ensure shield angle and head harness size are correctly set
- Ensure Pivot Nuts are secure
- Ensure Welding Filter and Cover Lenses are correctly fitted and undamaged
- Ensure correct shade setting is selected
- Inspect Head Harness and Air Duct
- Ensure all parts are free from cracks and splits - replace if necessary

### Monthly

- Carry out all the 'Before Use' inspections and create record of this monthly check

### After Use

- Clean with cloth dampened with a mild solution of water and liquid household soap
- Disinfect with 3M™ 105 Wipes
- Store in a dry, clean area / locker away from direct sunlight, high temperatures and solvents

### Ordering Consumables, Repair Parts and Accessories

To request a quote or place an order for these items, please contact your 3M Approved Distributor.

### Further Information and Advice

If you require additional guidance on the Care and Maintenance of your 3M Powered and Supplied Air Equipment, please contact the Helpline or your local 3M representative.

**The Power to Protect Your World**


**3M Health & Safety Helpline**

Monday - Friday 9 to 5

**0870 60 800 60 UK**

**1 800 320 500 IRELAND**

**EMR PELTOR**

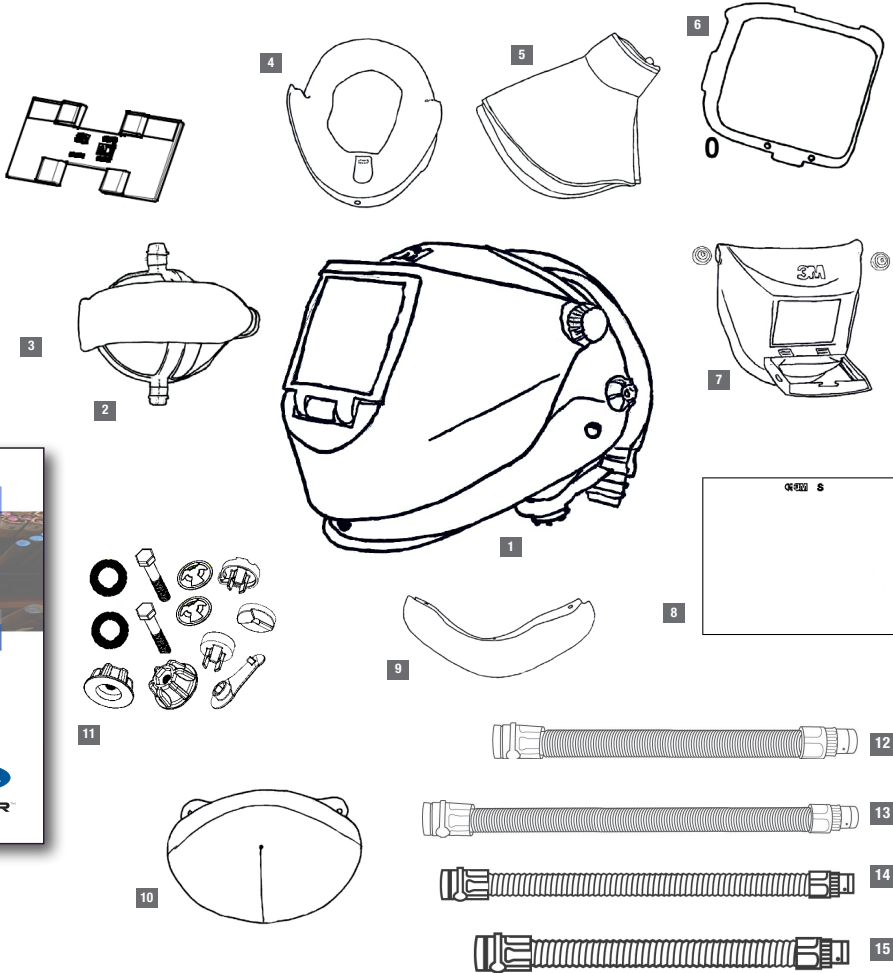

		3M Part No
1	HT-629 Welding Visor Headtop	HT-629
2	600 Series Airduct Harness Assembly	HNS-14
3	Comfort Bands - 600 Series (pair)	CMF-09
4	Face Seal	FSL-22
5	Proban™ Welding Cape	WLD-12
6	Visor Shade 0	VIS-21
7	Welding Overvisor	WLD-08
8	90 x 110mm Outer Cover Lens	WLN-13
9	Leather Neck Extension	WLD-11
10	Leather Head Cover	WLD-15
11	Pivot screws spares kit	528772
	Lens retainer spring	WLD-13
	Speedglas™ 100V Auto Darkening Filter Variable 3/8 - 12	750020
	Visor anti-mist kit 111	530-19-16P
	Disinfectant wipes 105	3M 105
12	Breathing Tube, small/medium	BT-20S
13	Breathing Tube, medium/large	BT-20L
14	Length Adjusting Breathing Tube	BT-30
15	Heavy Duty Rubber Breathing Tube	BT-40
	Protective cover for breathing tubes	BT-926

The solution for welders needing a welding shield with a wide-view clear visor beneath. The 90 x 110mm holder hinges down for easy access. Conventional or auto-darkening filters can be fitted.

@3M\_UK\_Safety

**3M Personal Safety Division**  
**3M United Kingdom plc**  
3M Centre  
Cain Road, Bracknell  
Berkshire RG12 8HT  
Tel: 0870 60 800 60  
www.3M.co.uk/Safety

**3M Ireland Limited**  
The Iveagh Building  
The Park  
Carrickmines  
Dublin 18  
Tel: 1 800 320 500

17808  
3M is a trademark of 3M Company  
Please recycle. Printed in UK.  
© 3M 2014. All rights reserved.

**REPLACE ALL DAMAGED PARTS IMMEDIATELY TO ENSURE  
CORRECT LEVELS OF PROTECTION**



CHHT629CMP

To download this poster please visit:  
www.3M.co.uk/maintenancepack or scan the QR code

